


TOLERANCE UNLESS SPECIFIED = .XXX = +/- .005 .XX = +/- .015 FRACTIONS = +/- .032
FP56-100.DC2

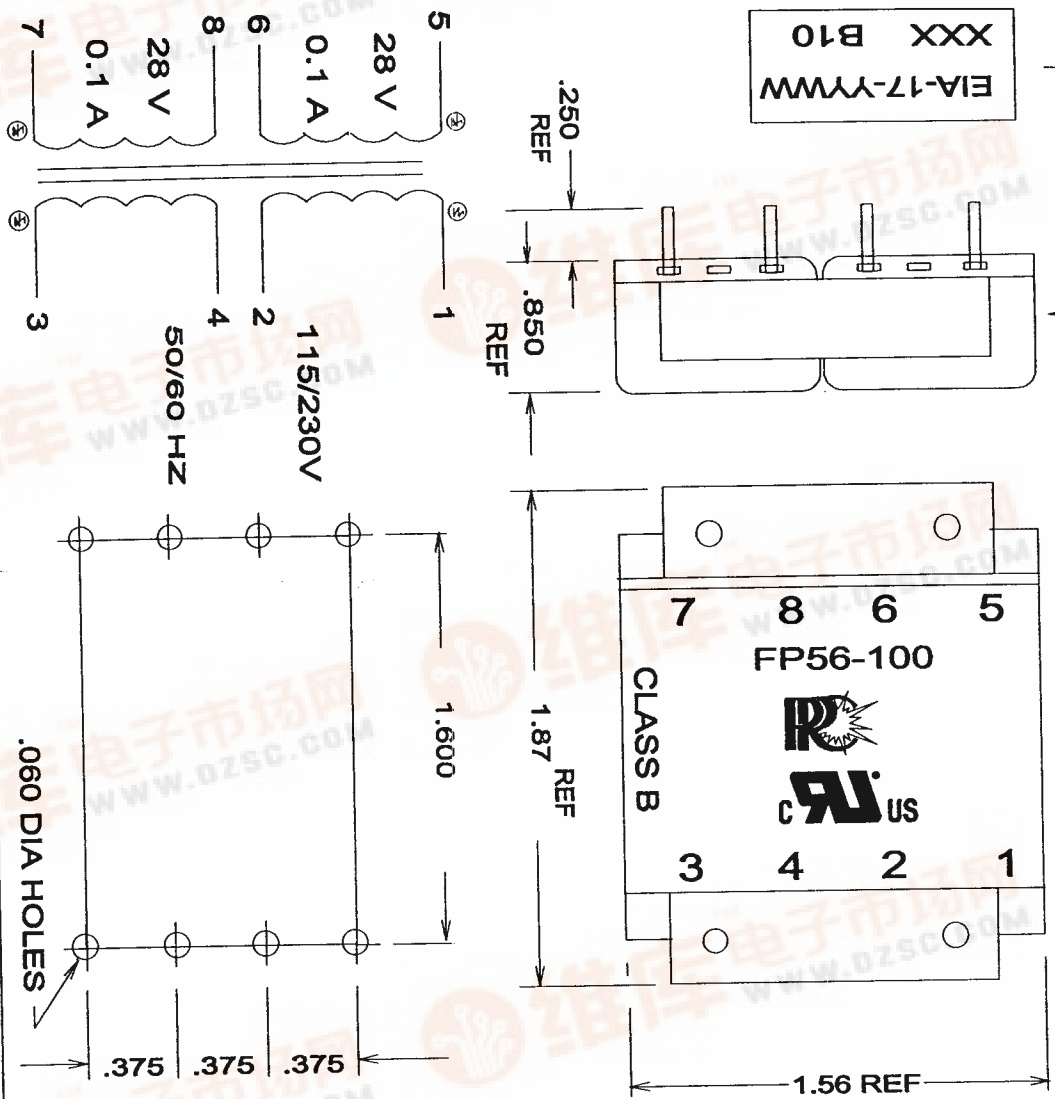

METHOD 1 X 1 **MARKING** PRINTED WRAPPER
 DATE CODE ON LABEL AS SHOWN ABOVE.

PRODUCTION TESTS

TURN'S RATIO = 100%

DC 1-2 = 3-4 = 360 TO 440

RESISTANCE 5-6 = 7-8 = 48 TO 58

IN OHMS

MAX EXCITATION CURRENT = 14 MA

APPLY = 230V, 60 HZ, 1-4, TIE 2+3

OPEN CIRCUIT VOLTAGE:

EACH PRI = 114.5 TO 115.5 V

EACH SEC = 38.3 TO 39.8 V

HIPOT = 2000 V PRI'S TO SEC'S

1500V PRI'S, SEC'S TO CORE

500V P-P, S-S

IMPREGNATION NOTES = PREHEAT 2 HRS

PINS TO BE FREE OF EPOXY

FINAL ASSEMBLY NOTES

PDF PART NO.: FP56-100