

FUSES

Resettable fuses

PFRA


Wire leaded PTC-Fuses Type PFRA

Cured, flame retardant epoxy
Polymer insulating material
meets UL 94V-0
requirements
Bulk packaging and tape
and reel available on most
models
Agency recognition:
**UL, CSA, TÜV




Typical Part Marking PFRA.030-900

Layout may vary

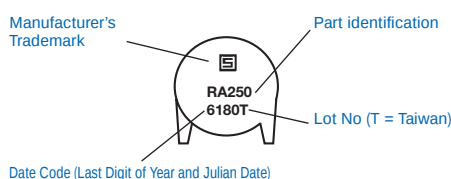


Typical Part Marking PFRA.010-025


Layout may vary

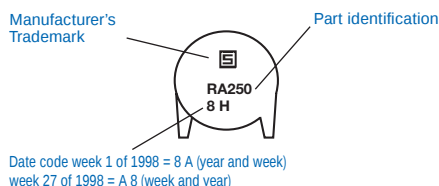

Typical Time to Trip at 23 °C

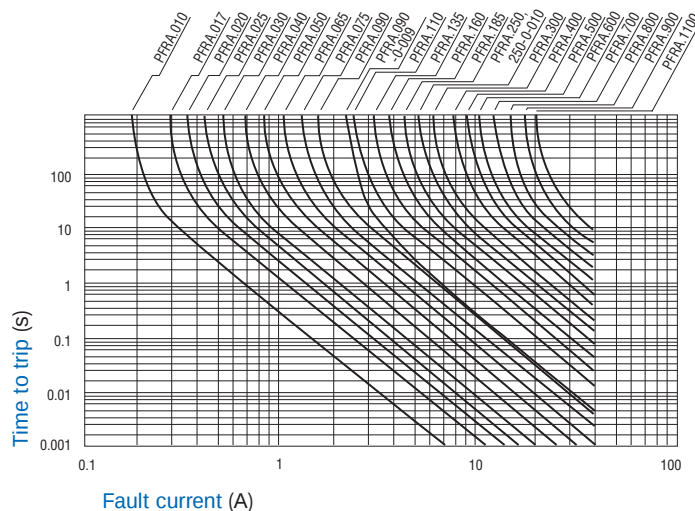

Package

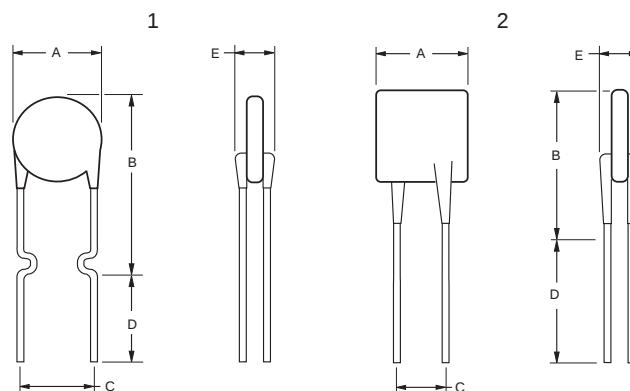

Kinked lead options available for board standoff

** PFRA.010-050 rated at 30 V

Applications

Almost anywhere there is a
low voltage power supply
and a load to be protected,
including:

- Computers and peripherals
- Transformer for toys
- Motors/fans

Environmental Characteristics

Operating/Storage Temperature	-40 °C to +85 °C	
Maximum Device Surface Temperature in Tripped State	125 °C	
Passive Aging	+85 °C, 1000 hours	±5% typ. resist. change
Humidity Aging	+85 °C, 85% R.H. 1000 hours	±5% typ. resist. change
Thermal Shock*)	+85 °C/-40 °C 10 times	±10% typ. resist. change
Mechanical Shock	MIL-STD-202, Method 213, Condition 1 (100 g, 6 sec.)	No resistance change
Solvent Resistance	MIL-STD-202, Method 215	No change
Vibration	MIL-STD-883C, Method 2007.1, Condition A	No change

*) MIL-STD-202F, Method 107G

Test Procedures And Requirements For Model PFRA Series

Test	Test Conditions	Accept/Reject Criteria
Visual/Mech.	Verify dimensions and materials	Per PF physical description
Resistance	In still air @ 23 °C	$R_{min} \leq R \leq R_{max}$
Time to Trip	At specified current V_{max} , 23 °C	$T \leq \text{max. time to trip (sec.)}$
Hold Current	30 min. at I_{hold}	No trip
Trip Cycle Life	V_{max} , I_{max} , 100 cycles	No arcing or burning
Trip Endurance	V_{max} , 48 hours	No arcing or burning

Electrical Characteristics

Type	V _{max} V	I _{max} A	I _{hold}	I _{trip}	Initial Resistance		1 Hour (R1) Post-Trip Resistance	Max. Time to trip at 23 °C	Tripped Power Dissipation
			Amperes	at 23 °C	Ohms at 23 °C		Ohms at 23 °C	Seconds at 23 °C	Watts at 23 °C
			Hold	Trip	min.	max.	R _{1 max.}		
PFRA.010.X	60	40	0.10	0.20	2.50	4.50	7.50	4.0	0.38
PFRA.017.X	60	40	0.17	0.34	3.30	5.21	8.00	3.0	0.48
PFRA.020.X	60	40	0.20	0.40	1.50	2.84	4.40	2.2	0.40
PFRA.025.X	60	40	0.25	0.50	1.00	1.95	3.00	2.5	0.45
PFRA.030.X	60	40	0.30	0.60	0.76	1.36	2.10	3.0	0.50
PFRA.040.X	60	40	0.40	0.80	0.52	0.86	1.29	3.8	0.55
PFRA.050.X	60	40	0.50	1.00	0.41	0.77	1.17	4.0	0.75
PFRA.065.X	60	40	0.65	1.30	0.27	0.48	0.72	5.3	0.90
PFRA.075.X	60	40	0.75	1.50	0.18	0.40	0.60	6.3	0.90
PFRA.090.X	60	40	0.90	1.80	0.14	0.31	0.47	7.2	1.00
PFRA.110.X	30	40	1.10	2.20	0.10	0.18	0.27	6.6	0.70
PFRA.135.X	30	40	1.35	2.70	0.065	0.115	0.17	7.3	0.80
PFRA.160.X	30	40	1.60	3.20	0.055	0.105	0.15	8.0	0.90
PFRA.185.X	30	40	1.85	3.70	0.04	0.07	0.11	8.7	1.00
PFRA.250.X	30	40	2.50	5.00	0.025	0.048	0.07	10.3	1.20
PFRA.300.X	30	40	3.00	6.00	0.02	0.05	0.08	10.8	2.00
PFRA.400.X	30	40	4.00	8.00	0.01	0.03	0.05	12.7	2.50
PFRA.500	30	40	5.00	10.00	0.01	0.03	0.05	14.5	3.00
PFRA.600	30	40	6.00	12.00	0.005	0.02	0.04	16.0	3.50
PFRA.700	30	40	7.00	14.00	0.005	0.02	0.03	17.5	3.80
PFRA.800	30	40	8.00	16.00	0.005	0.02	0.03	18.8	4.00
PFRA.900	30	40	9.00	18.00	0.005	0.01	0.02	20.0	4.20
PFRA.1100	16	100	11.00	22.00	0.003	0.01	0.014	20.0	4.50

Packaging

Bulk
(leave.X space)

500 per bag

Tape and reel
X=.2

PFRA.010–PFRA.160 –12.7 mm device pitch = 3000 pcs. per reel ;
PFRA.185–PFRA.400 – 25.4 mm device pitch = 1500 pcs. per reel

Dimensions

Type	A	B	C		D	E	Style	Lead	Material
	max.	max.	nominal	Tol. ±	min.	max.			
PFRA.010.X	7.4	12.7	5.1	0.7	7.6	3.1	1	0.51 dia./ Ø	Sn/NiCu
PFRA.017.X	7.4	12.7	5.1	0.7	7.6	3.1	1	0.51 dia./ Ø	Sn/NiCu
PFRA.020.X	7.4	12.7	5.1	0.7	7.6	3.1	1	0.51 dia./ Ø	Sn/CuFe
PFRA.025.X	7.4	12.7	5.1	0.7	7.6	3.1	1	0.51 dia./ Ø	Sn/CuFe
PFRA.030.X	7.4	13.4	5.1	0.7	7.6	3.1	1	0.51 dia./ Ø	Sn/CuFe
PFRA.040.X	7.4	13.7	5.1	0.7	7.6	3.1	1	0.51 dia./ Ø	Sn/CuFe
PFRA.050.X	7.9	13.7	5.1	0.7	7.6	3.1	1	0.51 dia./ Ø	Sn/Cu
PFRA.065.X	9.7	15.2	5.1	0.7	7.6	3.1	1	0.51 dia./ Ø	Sn/Cu
PFRA.075.X	10.4	16.0	5.1	0.7	7.6	3.1	1	0.51 dia./ Ø	Sn/Cu
PFRA.090.X	11.7	16.7	5.1	0.7	7.6	3.1	1	0.51 dia./ Ø	Sn/Cu
PFRA.090.X	7.4	12.2	5.1	0.7	7.6	3.0	2	0.51 dia./ Ø	Sn/Cu
PFRA.110.X	8.9	14.0	5.1	0.7	7.6	3.0	1	0.51 dia./ Ø	Sn/Cu
PFRA.135.X	8.9	18.9	5.1	0.7	7.6	3.0	1	0.51 dia./ Ø	Sn/Cu
PFRA.160.X	10.2	16.8	5.1	0.7	7.6	3.0	1	0.51 dia./ Ø	Sn/Cu
PFRA.185.X	12.0	18.4	5.1	0.7	7.6	3.0	1	0.51 dia./ Ø	Sn/Cu
PFRA.250.X	12.0	18.3	5.1	0.7	7.6	3.0	2	0.81 dia./ Ø	Sn/Cu
PFRA.250.X	12.0	18.3	5.9	0.7	7.6	3.1	2	0.51 dia./ Ø	Sn/Cu
PFRA.300.X	12.0	18.3	5.1	0.7	7.6	3.0	2	0.81 dia./ Ø	Sn/Cu
PFRA.400.X	14.4	24.8	5.1	0.7	7.6	3.0	2	0.81 dia./ Ø	Sn/Cu
PFRA.500	17.4	24.9	10.2	0.7	7.6	3.0	2	0.81 dia./ Ø	Sn/Cu
PFRA.600	19.3	31.9	10.2	0.7	7.6	3.0	2	0.81 dia./ Ø	Sn/Cu
PFRA.700	22.1	29.8	10.2	0.7	7.6	3.0	2	0.81 dia./ Ø	Sn/Cu
PFRA.800	24.2	32.9	10.2	0.7	7.6	3.0	2	0.81 dia./ Ø	Sn/Cu
PFRA.900	24.2	32.9	10.2	0.7	7.6	3.0	2	0.81 dia./ Ø	Sn/Cu
PFRA.1100	24.2	32.9	10.2	0.7	7.6	3.0	2	0.81 dia./ Ø	Sn/Cu

FUSES

Resettable fuses

PFRA

Thermal Derating Chart- I_{hold} (Amps)

Type	Ambient Operating Temperature								
	-40 °C	-20 °C	0 °C	23 °C	40 °C	50 °C	60 °C	70 °C	85 °C
PFRA.010.X	0.16	0.14	0.12	0.10	0.08	0.07	0.06	0.05	0.04
PFRA.017.X	0.26	0.23	0.20	0.17	0.14	0.12	0.11	0.09	0.07
PFRA.020.X	0.31	0.27	0.24	0.20	0.16	0.14	0.13	0.11	0.08
PFRA.025.X	0.39	0.34	0.30	0.25	0.20	0.18	0.16	0.14	0.10
PFRA.030.X	0.47	0.41	0.36	0.30	0.24	0.22	0.19	0.16	0.12
PFRA.040.X	0.62	0.54	0.48	0.40	0.32	0.29	0.25	0.22	0.16
PFRA.050.X	0.78	0.68	0.60	0.50	0.41	0.36	0.32	0.27	0.20
PFRA.065.X	1.01	0.88	0.77	0.65	0.53	0.47	0.41	0.35	0.26
PFRA.075.X	1.16	1.02	0.89	0.75	0.61	0.54	0.47	0.41	0.30
PFRA.090.X	1.40	1.22	1.07	0.90	0.73	0.65	0.57	0.49	0.36
PFRA.110.X	1.60	1.43	1.27	1.10	0.91	0.85	0.75	0.67	0.57
PFRA.135.X	1.96	1.76	1.55	1.35	1.12	1.04	0.92	0.82	0.70
PFRA.160.X	2.32	2.08	1.84	1.60	1.33	1.23	1.09	0.98	0.83
PFRA.185.X	2.68	2.41	2.13	1.85	1.54	1.42	1.26	1.13	0.96
PFRA.250.X	3.63	3.25	2.88	2.50	2.08	1.93	1.70	1.53	1.30
PFRA.300.X	4.35	3.90	3.45	3.00	2.49	2.31	2.04	1.83	1.56
PFRA.400.X	5.80	5.20	4.60	4.00	3.32	3.08	2.72	2.44	2.08
PFRA.500	7.25	6.50	5.75	5.00	4.15	3.85	3.40	3.05	2.60
PFRA.600	8.70	7.80	6.90	6.00	4.98	4.62	4.08	3.66	3.12
PFRA.700	10.15	9.10	8.05	7.00	5.81	5.39	4.76	4.72	3.64
PFRA.800	11.60	10.40	9.20	8.00	6.64	6.16	5.44	4.88	4.16
PFRA.900	13.05	11.70	10.35	9.00	7.47	6.39	6.12	5.49	4.68
PFRA.1100	16.10	14.60	13.10	11.00	9.40	8.80	7.80	6.90	5.20

How To Order

PTC-Fuse **PF** **RA . XXX . X**

Style **RA** = Radial Leaded Component

Hold Current, I_{hold}
010-1100 (100 mA–11,0 A)

Packaging Options
- = Bulk Packaging
.2 = Tape and Reel*

*Packaged per E1486-B